



TECHNICAL BULLETIN

Up-Right, Inc. 401 Roland Way, Oakland, CA 94621 Tel. (415) 430-0700 Fax (415) 569-7899

DATE: JUNE 5, 1992

BULLETIN NUMBER: SB 92.3

SUBJECT: UPRIGHT LIFT POWER UNIT MALFUNCTION

MODEL AFFECTED: UL 220 VOLTS A.C. UNITS ONLY
WITH DATE CODE F492

SERIAL NUMBERS AFFECTED: 8469 THROUGH 8570
For Instant Deutschland, there is a total of 28 machines that could be suspect. The serial numbers are listed below.

8469, 8470, 8471, 8472, 8473, 8474, 8486, 8487, 8488, 8498, 8499, 8500, 8501, 8502, 8503, 8504, 8505, 8509, 8510, 8511, 8512, 8513, 8514, 8516, 8517, 8519, 8520, 8521

PURPOSE: This service bulletin is being provided to alert distributors of a possible reliability problem concerning A.C. powered UpRight Lift motors. We have discovered that a small number of UL's may have been shipped with motors having excessive current draw.

OPERATION REQUIRED: The motor installed in power units with a date code F492 may have an internal wiring problem. This date code is stamped on the nomenclature plate on the motor in a space labeled "SER".

Inspect power unit for date code. If the date code is other than F492, the power unit is not suspect. Any power unit with the suspect date code requires an amperage draw check. Normal operating current is 5-6 amps. Suspect power units will have an operating amp draw of 15-20 amps. Any power unit with abnormally high current requirements should be replaced.

REIMBURSEMENT: Please follow normal warranty procedures and full credit will be given to any suspect power unit that is returned to UpRight, 1775 Park Street, Selma, CA 93662.

This test and repair can be completed in one (1) hour.

If you have any questions regarding this product bulletin, please contact the UpRight Product Support Department at 209/896-5150 or by fax at 209/896-9244.

TECHNICAL BULLETIN

Up-Right, Inc. 401 Roland Way, Oakland, CA 94621 Tel. (415) 430-0700 Fax (415) 569-7899

DATE: JUNE 5, 1992

BULLETIN NUMBER: SB 92.3

SUBJECT: UPRIGHT LIFT POWER UNIT MALFUNCTION

MODEL AFFECTED: UL 220 VOLTS A.C. UNITS ONLY
WITH DATE CODE F492

SERIAL NUMBERS AFFECTED: 8469 THROUGH 8570
For Getz Bros. & Co. Ltd., there is a total of 6 machines that could be suspect. The serial numbers are listed below.
8532, 8533, 8534, 8560, 8562, 8563

PURPOSE: This service bulletin is being provided to alert distributors of a possible reliability problem concerning A.C. powered UpRight Lift motors. We have discovered that a small number of UL's may have been shipped with motors having excessive current draw.

OPERATION REQUIRED: The motor installed in power units with a date code F492 may have an internal wiring problem. This date code is stamped on the nomenclature plate on the motor in a space labeled "SER".
Inspect power unit for date code. If the date code is other than F492, the power unit is not suspect. Any power unit with the suspect date code requires an amperage draw check. Normal **operating** current is 5-6 amps. Suspect power units will have an **operating** amp draw of 15-20 amps. Any power unit with abnormally high current requirements should be replaced.

REIMBURSEMENT: Please follow normal warranty procedures and full credit will be given to any suspect power unit that is returned to UpRight, 1775 Park Street, Selma, CA 93662.
This test and repair can be completed in one (1) hour.
If you have any questions regarding this product bulletin, please contact the UpRight Product Support Department at 209/896-5150 or by fax at 209/896-9244.