

SERVICE BULLETIN SB00.12

Machines/Models:MX15/19

Serial Numbers: 14000 -14167

THE PROCEDURE SPECIFIED IN THIS BULLETIN **MUST** BE PERFORMED AT THE NEXT 30 DAY MAINTENANCE INTERVAL.

DATE: July 1, 2000

PURPOSE: Eliminate the possibility of water ingress into the motor controller

PROCEDURE REQUIRED: Replace the motor controller

PARTS REQUIRED: 1 each - kit part number SB00.12 includes the following:

KIT INCLUDES: 1 each - 065708-001 motor controller

REIMBURSEMENT: UpRight will reimburse the owner of record for 1 hour of labor at \$60.00 per hour. Reimbursement will be made upon receipt by UpRight of your completed Warranty Claim Form. Please reference SB00.12 on your Warranty Claim Form.

PROCEDURE: Read all instructions thoroughly and refer to Figure 1 before starting.

1. Open the Chassis doors to gain access to the motor controller and batteries (see Figure 1).
2. Remove the battery negative cable from the batteries.
3. Label the wires and cables connected to the motor controller for reinstallation.
4. Remove all wires and cables to the Motor Controller.
5. Remove the motor controller and retain (this motor controller is to be returned to UpRight with the completed Warranty Claim Form).
6. Install the supplied motor controller, torque attachment bolts to 18 to 20 Ft. Lbs (25-27 Nm).
7. Attach and secure the wiring and cables per the labels installed in step #3.
8. Reattach the battery negative cable disconnected in step #2.
9. Perform the Pre-Operation and Safety inspection as instructed in the Operator Manual to ensure proper operation of machine.

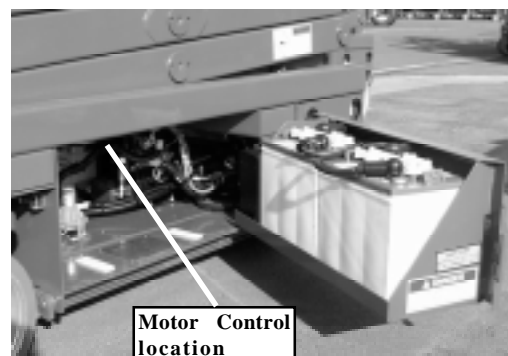
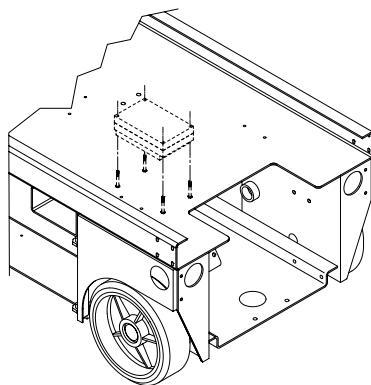


Figure 1

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (559) 891-5200 outside the USA or by FAX at (559) 891-8931.