

SERVICE BULLETIN SB98.9

Machines/Models: SP37 & TL49

Serial Numbers:
SP37 1001-1345
TL49 1001-1135

THIS BULLETIN IS A SERVICE ADVISORY TO BE CARRIED OUT AT THE NEXT SERVICE INTERVAL.

DATE: June 24, 1998

PURPOSE: To increase the protection against abrasion and wear on the electrical harness between the Upper Control Box and Lower Control Box.

OPERATION REQUIRED: Installation of Cable Protection Coil on electrical harness between Upper Control Box and Lower Control Box in designated area.

PARTS REQUIRED:

1. 1 ea. #500407-000 Cable Protection Coil, 0.8m, 2.62 ft.
2. 5 ea. Tie Wraps

REIMBURSEMENT: UpRight will reimburse the owner of record for up to 1/4 hour of labor at \$30.00 per hour. Reimbursement will be made upon receipt by UpRight of your completed warranty claim form. Please reference SB98.9 on your warranty claim form.

PROCEDURE: Read all instructions thoroughly and refer to figure 1 before starting.

1. Remove the Access Panel from the side of the Second Post. Check that the Electrical harness is not cable tied internally and is free of any damage.
2. Ensure that there is some movement of the harness relative to the cables and the Second Post.
3. Clip the Harness Protection Coil around the harness above entry point **A**. See figure 1. Ensure that the full length of Coil is wrapped around the harness external to the Second Post.
4. Tie wrap the Harness Protection Coil loosely in three places.
5. Examine the harness and hose routing inside of the Second Post using the Access Panel.
6. Slide the Harness Protection Coil down the Harness and thread it through the Second Post until it has come out of entry point **B**. See figure 2.
7. Tighten the Tie Wraps so that the Harness Protection Coil is secure. Tie Wrap the Coil loosely to the hoses within the Second Post. This will eliminate excessive movement.

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (209) 891-5200 outside the USA or by FAX at (209) 896-9244.

SERVICE BULLETIN

SB98.9

Machines/Models: SP37 & TL49

Serial Numbers:

SP37 1001-1345

TL49 1001-1135

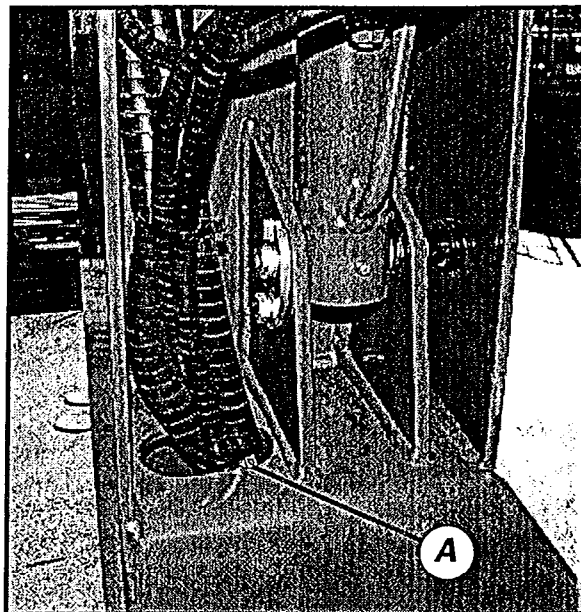


Figure 1

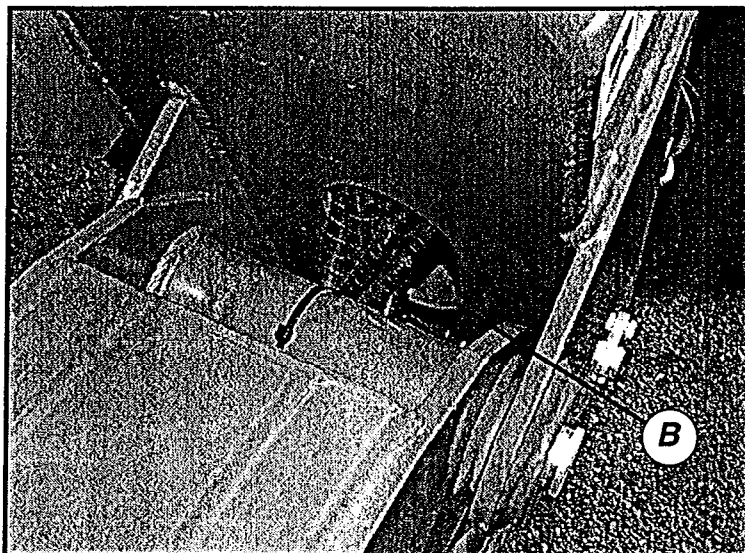


Figure 2

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (209) 891-5200 outside the USA or by FAX at (209) 896-9244.