



SERVICE BULLETIN SB99.5

Machines/Models: AB46 Electric & Bi-Energy

Serial Numbers:
1000-1768

THIS BULLETIN IS A SERVICE ADVISORY TO BE CARRIED OUT AT THE NEXT SERVICE INTERVAL.

DATE: June 1, 1999

PURPOSE: Filter control signal.

OPERATION REQUIRED: Install Rheostat Control Filter.

PARTS REQUIRED: Kit SB99.5 includes the following:

1. 1 ea. Rheostat Filter #068593-012
2. 2 ea. 6" Tie Wraps

REIMBURSEMENT: UpRight will reimburse the owner of record for 1/2 hour of labor at \$35.00 per hour. Reimbursement will be made upon receipt by UpRight of your completed warranty claim form. Please reference SB99.5 on your warranty claim form.

PROCEDURE: Read all instructions thoroughly and refer to figure 1 before starting.

1. Disconnect the negative terminal from the battery.
2. Locate rheostat card in upper control box. See Figure 1.
3. Remove red wire from + terminal on rheostat card.
4. Attach red wire, removed in step 3, to + terminal on Rheostat Filter (#068593-012).
5. Remove black wire from - terminal on rheostat card.
6. Attach black wire, removed in step 5, to - terminal on Rheostat Filter (#068593-012).
7. Attach red wire from filter to + terminal on rheostat card. See Figure 2.
8. Attach black wire from filter to - terminal on rheostat card. See Figure 2.
9. Attach Rheostat Filter to black wire with tie wraps as shown in Figure 2.
10. Reconnect negative battery cable.
11. Perform Pre-Operation and Safety Inspection as instructed in the Operator Manual.

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (559) 891-5200 outside the USA or by FAX at (559) 896-9244.

SERVICE BULLETIN SB99.5

Machines/Models: AB46 Electric & Bi-Energy

**Serial Numbers:
1000-1768**

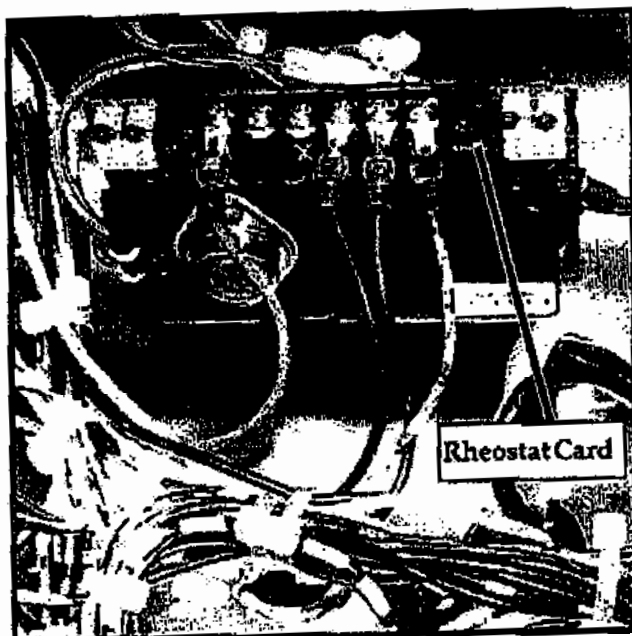


Figure 1

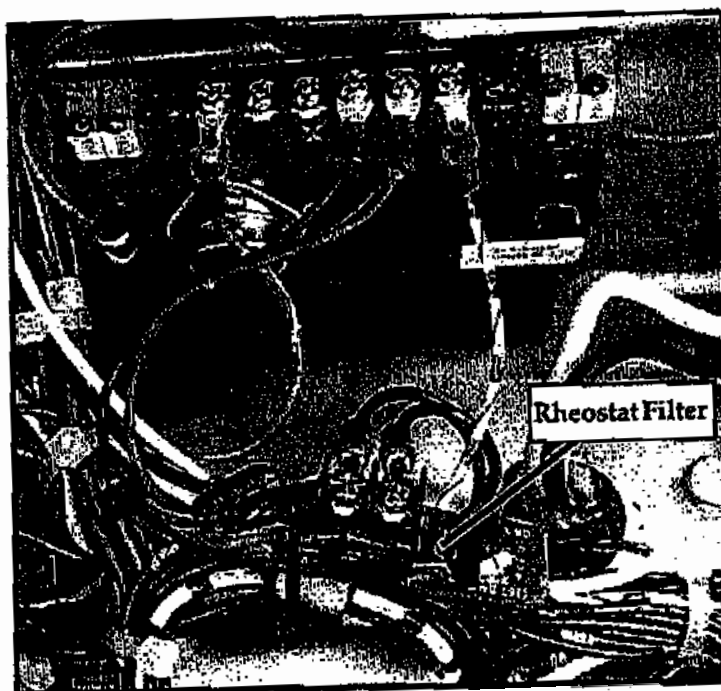


Figure 2

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (559) 891-5200 outside the USA or by FAX at (559) 896-9244.