

SERVICE INFORMATION LETTER SI 02.01

Machines/Models: SB80

Serial Numbers: All

DATE: January 3, 2001

PURPOSE: Convey to Customers that the Cold and Warm Weather Testing has been Completed and UpRight Inc. has Determined that the Hydraulic Fluid Cooler is No Longer Required.

PROCEDURE REQUIRED: Re-route Tank Line from Hydraulic Oil Cooler Directly to the Pump (Bypassing the Oil Cooler).

PROCEDURE: Necessary in Cold Weather Areas.

PARTS REQUIRED: 011941-027

WARRANTY REIMBURSEMENT: None.

Note to All Customers Operating SB80's

After controlled testing it has been determined that the hydraulic fluid cooler on the SB80 is not necessary for operation of the machine and does not offer any significant benefit to the hydraulic system. The fluid cooler when operated in severe cold weather can cause gasket failure within the hydraulic pump. IT IS RECOMMENDED AND ALLOWABLE TO BY-PASS THE HYDRAULIC FLUID COOLER AND ELIMINATE THE COOLER ENTIRELY FROM THE MACHINE.

Fitting number 011941-027 will allow the hydraulic fluid cooler hose coming from the tank to attach directly to the pump.

If you have any questions regarding this Service Information Letter, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (559) 891-5200 outside the USA or by FAX at (559) 891-8931.