


# SERVICE BULLETIN SB98.19

## Machines/Models: MX15/19

**Serial Numbers:**8791-9379, 9381-9549, 9553-9570  
9572-9598, 9602-9687, 9691-9694,  
9698-9708, 9714-9730, 9732-9733, 9759**THIS BULLETIN IS MANDATORY.****DATE:** October 12, 1998**PURPOSE:** To provide additional clearance between the drive motor guards and the pothole protection bars.**OPERATION REQUIRED:** Remove material from motor guard as indicated below.**REIMBURSEMENT:** UpRight will reimburse the owner of record for up to 1/2 hour of labor at \$35.00 per hour and for travel (up to 100 miles) at \$0.25 per mile. Reimbursement will be made upon receipt by UpRight of your completed warranty claim form. Please reference SB98.19 on your warranty claim form.**PROCEDURE:** Read all instructions thoroughly and refer to figure 1 before starting. Platform must be in stowed position on a firm level surface.

1. Using the upper controls, turn steering wheels to full left.
2. Using an oxygen/acetylene cutting torch or equivalent cutting device remove the area off the aft corner of the left motor guard, as shown in figure 1.
3. Using the upper controls, turn steering wheels to full right.
4. Repeat step 2 for the right motor guard.

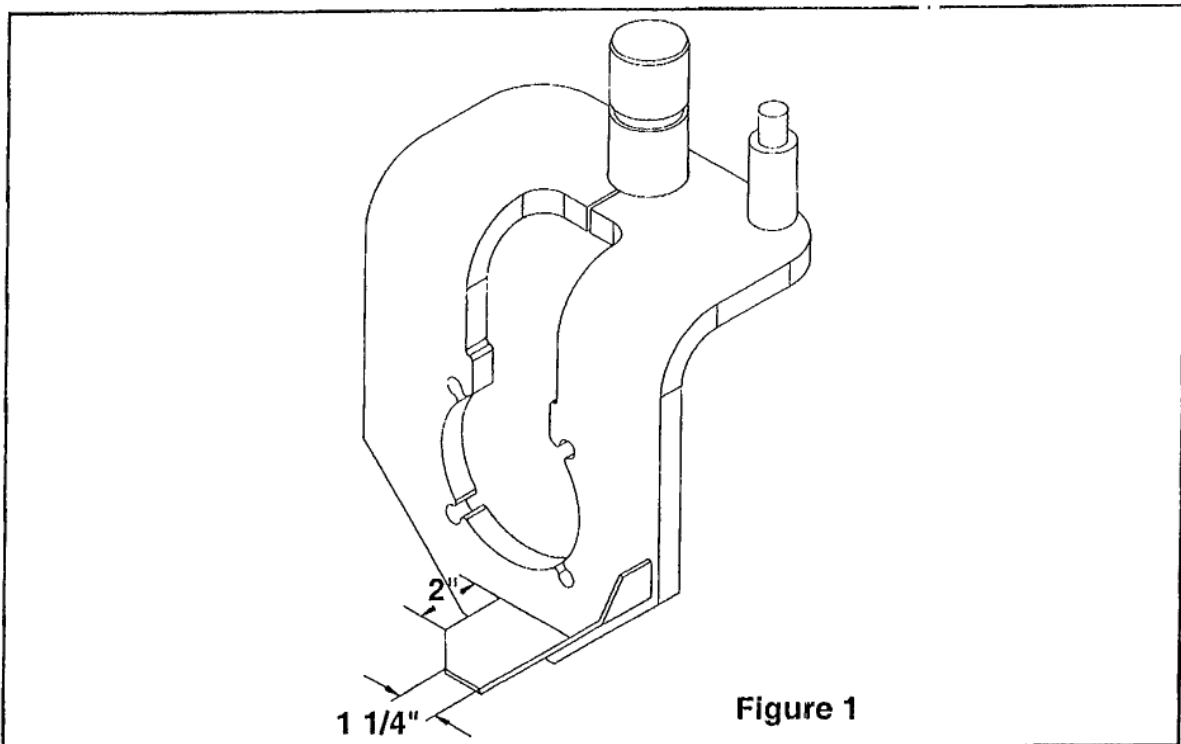

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (209) 891-5200 outside the USA or by FAX at (209) 896-9244.