

# SERVICE BULLETIN

**Machines/Models:** X-Series  
Work Platforms

**Serial Nos.:** 1000-1061

**SERVICE BULLETIN:** 94.9


**DATE:** July 1, 1994

**PURPOSE:** Notification of requirement to check wiring.

**OPERATION REQUIRED:** Check wiring per instructions and attached drawing to insure proper protection of wiring by circuit breaker.

**REIMBURSEMENT:** Procedure will take less than one half hour. UpRight will reimburse the dealer of record for up to one half hour of installation time at the dealer's shop rate. UpRight will also reimburse the dealer of record for reasonable travel time at the rate of USD \$25.00 per hour. Reimbursement will be made upon receipt of a properly completed warranty claim form.

- PROCEDURE:**
1. Push chassis emergency stop switch button down to OFF position.
  2. Open control module and remove cover from control box assembly.
  3. Inspect wires at emergency stop switch: One terminal will have 2-16 gauge wires, one red, one black. The other terminal will have one 10 gauge red wire. If no other wires are found inspection is complete. If there is another wire, trace to its destination. If this wire goes to terminal 12 on the electric box terminal strip, remove this jumper and replace with a 16 gauge jumper from terminal 12 to the center (B) pole of the key switch.
  4. Replace control box cover, close module and pull emergency stop switch button out to ON position. Operate the machine, testing each function to verify proper operation.

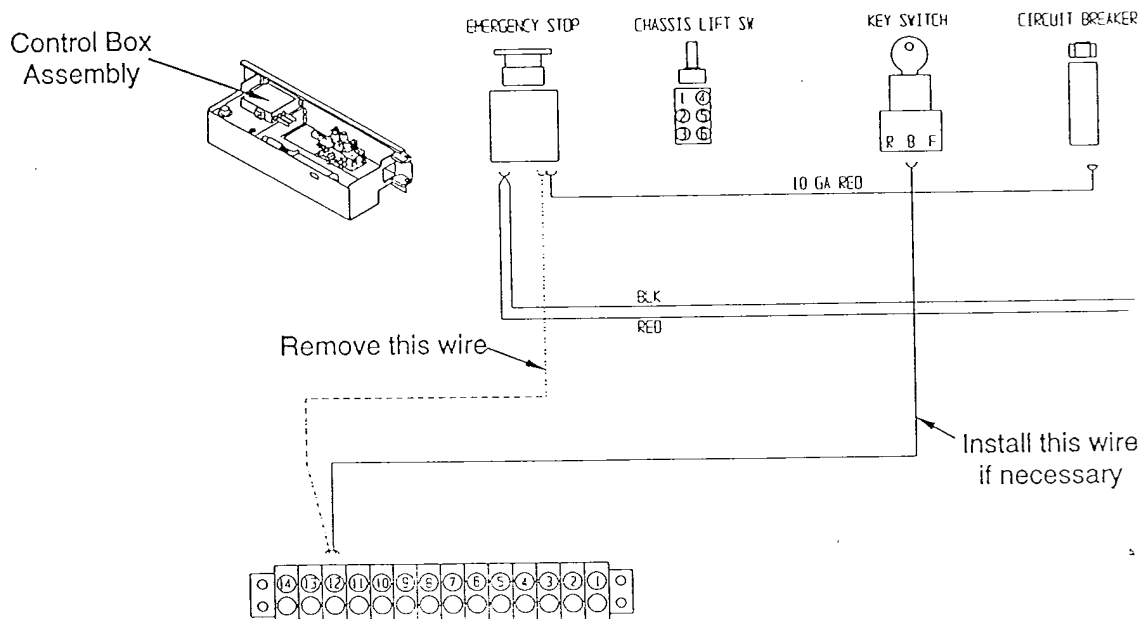

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department at (800) 926-5438, in the USA; (209) 896-5150, outside the USA; or by FAX at (209) 896-9244