

SERVICE BULLETIN**SB00.30****Machines / Models: MB20/26****THIS BULLETIN IS MANDATORY.****DATE:** 26, September, 2000.**PURPOSE:** To remove the risk of damage to the main harness cable by the action of the mast movement.**OPERATION REQUIRED:** To fit a replacement trunking cover by following the procedure detailed below.

PARTS REQUIRED: 1 off Trunking cover.

Part No.	500882-002	MB20
Part No.	500882-003	MB26

TOOLS REQUIRED: 5mm 'right angle' Allen key.**REIMBURSEMENT:** UpRight will reimburse the distributor of record for thirty minutes of labour at Euro 66.00 per hour and travel at Euro 0.55 per mile. (To a maximum of 100 miles return). Reimbursement will be made upon receipt by UpRight of your completed warranty claim form. Reference this service bulletin number (SB 00.30) on the warranty claim form.**MACHINES AFFECTED:** The following is a list of machines to which this service bulletin applies.

MB20 0002	MB26 0001
MB20 0003	MB26 0002
MB20 0005	MB26 0003
MB20 0006	MB26 0007
MB20 0007	
MB20 0008	
MB20 0011	

PROCEDURE:

Installation instructions for replacement cover.

1. Ensure that mast is brought to its fully lowered position.
2. Using the lower control box raise the jib until the jib members are horizontal as shown.




3. Remove the key from the lower control box and press in the emergency stop.
4. Using a 5mm Allen key, remove the two countersunk bolts shown below. The old trunking cover can now be removed. The trunking cover in question is the one closest to the lower control box side of the machine. Discard old trunking cover in an environmentally friendly manner.



Countersunk
Bolts

Cover to be removed

5. Fit the new trunking cover, shown below, and secure using previously removed countersunk bolts.

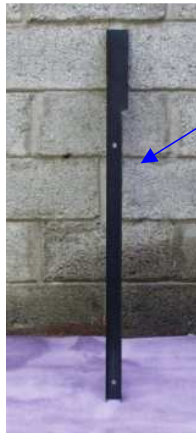

500882-003
MB26 MODEL

Extended section
To protect
Harness cable



500882-002
MB20 MODEL

6. Insert the key in the lower control box and lower the jib to it's stowed position.
7. Using the lower control box raise and lower the mast a number of times to ensure that the trunking cover is functioning properly and not causing any problems to the energy chain.

On completion of retro-fit please email the following details to

poneill@uprighteuro.com

Details:

- Machine serial no.
- Retrofit date.
- Name of person who performed retrofit.

Warranty claims should be forwarded to Anthony Burton in Upright Ireland.