

SERVICE BULLETIN SB98.11

Serial Numbers: 1001 - 1450

Machines/Models:AB46 Electric & Bi-Energy

THIS BULLETIN IS MANDATORY

DATE: August 10, 1998

PURPOSE: To ensure proper plug braking.

OPERATION REQUIRED: Rewire electric circuit.

PARTS REQUIRED: Jumper wire assembly (# 030905-000)

REIMBURSEMENT: UpRight will reimburse the owner of record for .5 hour of labor at \$30.00 per hour and reasonable travel at \$ 0.25 per mile. Reimbursement will be made upon receipt by UpRight of your completed warranty claim form. Please reference SB 98.11 on your warranty claim form.

PROCEDURE: Read all instructions thoroughly and refer to Figure 1 before starting.

- 1. Unplug battery connectors.
- 2. Remove engine compartment cover.
- 3. Remove electrical panel cover.
- 4. Locate orange wire attached to contactors (Figure 1).
- 5. Cut orange wire at diode connection on main power contactor.
- 6. Leaving diode in place, remove orange wire.
- 7. Install green wire on to forward and reverse contactors (Figure 1).
- 8. Insert green wire as shown, through holes in panel and attach to terminal #4.
- 9. Reinstall covers.
- 10. Connect batteries.
- 11. Perform full test of drive functions.

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (209) 891-5200 outside the USA or by FAX at (209) 896-9244.



SERVICE BULLETIN SB98.11

Serial Numbers: 1001 - 1450

Machines/Models: AB46 Electric & Bi-Energy

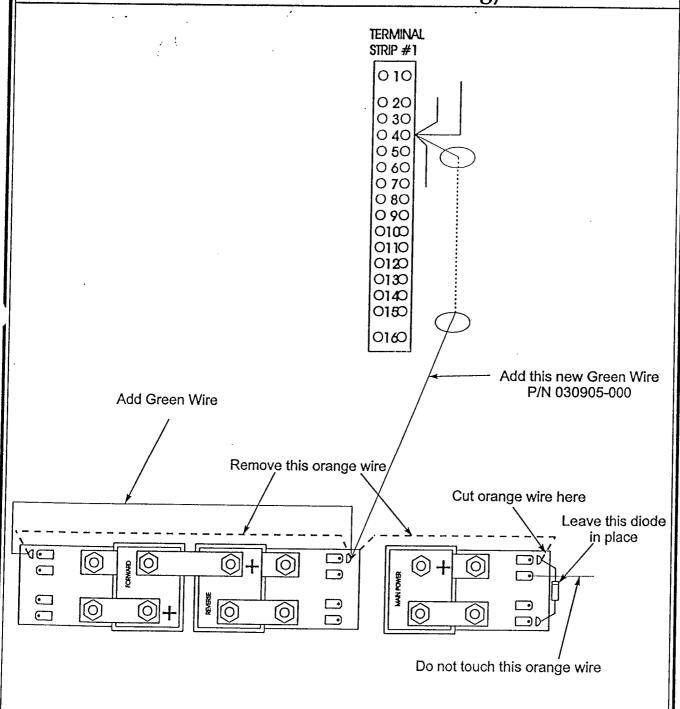


Figure 1

If you have any questions regarding this Service Bulletin, please contact the UpRight Product Support Department by telephone at (800) 926-5438 from within the USA or at (209) 891-5200 outside the USA or by FAX at (209) 896-9244.